


Hawema HSK50 // Shaft ø20 mm // RS ø50 mm

For Hawema tool grinding machines with ring set ø50 mm


GWA HSK50 // ø20 mm // RS ø50 mm

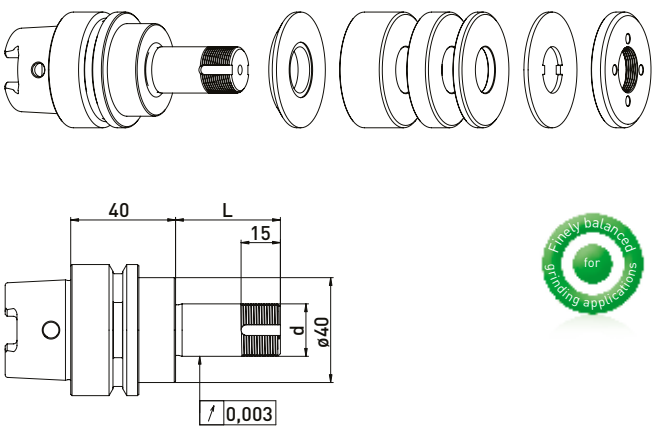

Delivered equipped:
Reducing washer, ring set ø50 mm, lock washer and clamping nut

| Order No. | HSK | d | L | Ring set ø50mm | | |
|-----------|-------|----|-----|----------------|------|-----|
| | | | | B 20 | B 10 | B 4 |
| 300012012 | HSK50 | 20 | 40 | - | 1 | 3 |
| 300012022 | HSK50 | 20 | 60 | 1 | 1 | 3 |
| 300012032 | HSK50 | 20 | 75 | 1 | 2 | 4 |
| 300012042 | HSK50 | 20 | 85 | 2 | 1 | 4 |
| 300012052 | HSK50 | 20 | 100 | 2 | 3 | 3 |

GWA HSK50 // ø20 mm // without RS

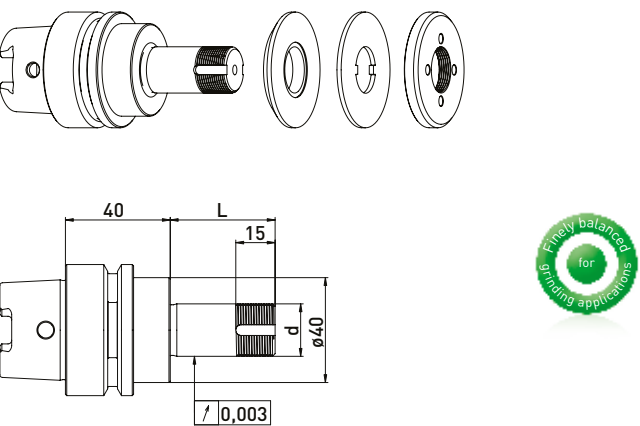

Delivered equipped:
Reducing washer, lock washer and clamping nut

| Order No. | HSK | d | L |
|-----------|-------|----|-----|
| 300012011 | HSK50 | 20 | 40 |
| 300012021 | HSK50 | 20 | 60 |
| 300012031 | HSK50 | 20 | 75 |
| 300012041 | HSK50 | 20 | 85 |
| 300012051 | HSK50 | 20 | 100 |

Accessories Hawema grinding wheel adapter HSK50 // ø20 mm // Ring set ø50 mm


| Order No. | Name |
|-----------|---|
| 350050010 | Universal assembly device ø50 |
| 350040010 | *Clamping nut wrench PC27 for ø20 |
| 350040011 | *Clamping nut wrench PC27 for ø20 |
| 350020021 | *Balancing weight pair for clamping nut ø50 // 100gmm |

| Order No. | Name |
|-----------|--|
| 350011020 | Spacer ring ø50 x ø20 x 20 |
| 350011010 | Spacer ring ø50 x ø20 x 10 |
| 350011004 | Spacer ring ø50 x ø20 x 4 |
| 350015002 | Reducing washer ø40 x ø50 x ø20 x 6 |
| 350030010 | Lock washer ø50 x ø20 x 2 |
| 350020060 | Clamping nut ø50 x 6 x M20 x 1 PC27 |
| 350020020 | *Clamping nut with balancing option ø50 x 8,5 M20 x 1,0 PC27 |
| 350015003 | Support washer ø50 x ø75 x ø20 x 6 |

Reinecker HSK50 // Shaft ø20 mm // RS ø35 mm

For Reinecker tool grinding machines with ring set ø35 mm with driver groove


SSA HSK50 // ø20 mm // RS ø35 mm

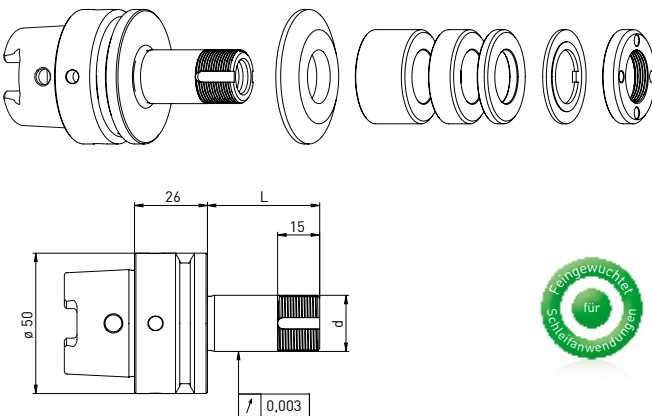

Delivered equipped:
Reducing washer, ring set ø35 mm, lock washer and clamping nut

| Order No. | HSK | d | L | Ring set ø35 mm | | |
|-----------|-------|----|-----|-----------------|------|-----|
| | | | | B 20 | B 10 | B 4 |
| 300072512 | HSK50 | 20 | 40 | - | 1 | 3 |
| 300072522 | HSK50 | 20 | 60 | 1 | 1 | 3 |
| 300072532 | HSK50 | 20 | 85 | 2 | 1 | 4 |
| 300072542 | HSK50 | 20 | 110 | 3 | 2 | 3 |
| 300072552 | HSK50 | 20 | 25 | - | - | 2 |
| 300072562 | HSK50 | 20 | 50 | - | 2 | 3 |
| 300072572 | HSK50 | 20 | 75 | 2 | 1 | 2 |

SSA HSK50 // ø20 mm // without RS

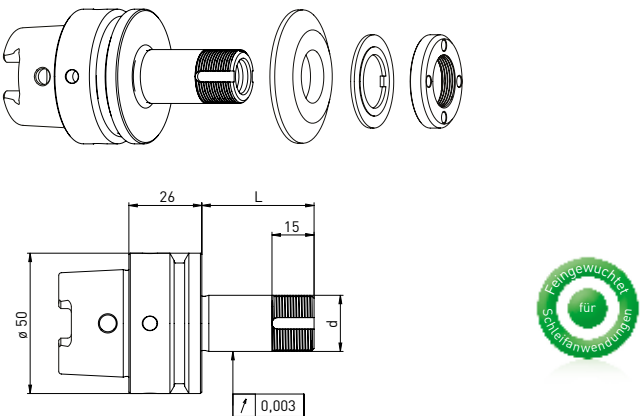


Delivered equipped:
Reducing washer, lock washer and clamping nut

| Order No. | HSK | d | L |
|-----------|-------|----|-----|
| 300072511 | HSK50 | 20 | 40 |
| 300072521 | HSK50 | 20 | 60 |
| 300072531 | HSK50 | 20 | 85 |
| 300072541 | HSK50 | 20 | 110 |
| 300072551 | HSK50 | 20 | 25 |
| 300072561 | HSK50 | 20 | 50 |
| 300072571 | HSK50 | 20 | 75 |

Accessories Reinecker grinding wheel adapter SSA HSK50 // ø20 mm // Ring set ø35 mm

| Order No. | Name |
|-----------|---|
| 350050010 | Universal assembly device ø50 |
| 350040010 | Clamping nut wrench PC27 for ø20 |
| 350040011 | Clamping nut wrench PC27 for ø20 |
| 350040040 | *Clamping nut wrench PC29 for ø20 for clamping nut with blancing option |
| 350040041 | *Clamping nut wrench PC29 for ø20 |
| 350020081 | *Balancing weight pair for clamping nut ø35 // 40gmm |



| Order No. | Name |
|-----------|---|
| 250000253 | Clamping screw Reinecker L40 - ø12 x 116 |
| 250000254 | Clamping screw Reinecker L60 - ø12 x 136 |
| 250000255 | Clamping screw Reinecker L85 - ø12 x 161 |
| 250000256 | Clamping screw Reinecker L110 - ø12 x 186 |

| Order No. | Name |
|-----------|--|
| 350012020 | Spacer ring ø35 x ø20 x 20 |
| 350012010 | Spacer ring ø35 x ø20 x 10 |
| 350012004 | Spacer ring ø35 x ø20 x 4 |
| 350015001 | Reducing washer ø50 x ø35 x ø20 x 6 |
| 350030020 | Lock washer ø35 x ø20 x 2 |
| 350020030 | Clamping nut ø35 x 6 M20 x 1 PC27 |
| 350020080 | *Clamping nut with balancing option ø35 x ø40 x 8 x M20 x 1 PC29 |
| 350015005 | Support washer ø35 x ø60 x ø20 x 6 |